

Tolerancing Optical Systems

- Why are tolerances important?
 - Somebody is going to make it (hopefully)
 - It must meet some performance requirement
 - Cost (and schedule) are always important
- Why is it difficult?
 - Involves complex relationships across disciplines
 - System engineering
 - Optical design and analysis
 - Optical fabrication
 - Opto-mechanical design
 - Mechanical fabrication
- If you can tolerance effectively, then you can be a good designer, otherwise you are not.

Process of optical system tolerancing

1. Define quantitative figures of merit for requirements
2. Estimate component tolerances
3. Define assembly/alignment procedure and estimate tolerances
4. Calculate sensitivities
5. Estimate performance
6. Adjust tolerances, balance cost and schedule with performance
7. Iterate with system engineer, fabricators, management

System Figure of Merit

- Keep this as simple as possible
- Must propagate all performance specs through assembly
- Typical requirements
 - *RMSWE (root mean square wavefront error)*
 - *MTF at particular spatial frequencies*
 - *Distortion*
 - *Fractional encircled energy*
 - *Beam divergence*
 - *Geometric RMS image size*
 - *Dimensional limits*
 - *Boresight*

Parameters to tolerance

Allowable errors are called tolerances.

What needs to be toleranced?

- General parts (usually machined metal)
- Physical dimensions of optical elements
- Optical surfaces
- Material imperfections for optics
- Optical assembly

Estimate system performance

For a merit function that uses RSS to combine independent contributions:

$$\Phi = \sqrt{\Phi_0^2 + (\Delta\Phi_1)^2 + (\Delta\Phi_2)^2 + \dots}$$

Φ_0 is from design residual – simulation of system with no manufacturing errors

$\Delta\Phi_i$ is effect from a single parameter having an error equal to its tolerance

Calculate sensitivities

- Define merit function Φ
- Make list of parameters to tolerance, x_1, x_2, x_3, \dots
all of the things that will go wrong.
- Use simulation to calculate the effect of each of these on the system performance.
 - For each x_i , use perturbation to find sensitivity

$$\frac{\partial\Phi}{\partial x_i} \cong \frac{\Delta\Phi}{\Delta x_i} = (\text{change in merit function}) / (\text{change in parameter})$$

- So the contribution from a tolerance Δx_i on parameter x_i is

$$\Delta\Phi_i = \frac{\partial\Phi}{\partial x_i} \Delta x_i = (\text{sensitivity}) * (\text{tolerance})$$

Sensitivity calculation

- If the nominal merit function Φ_0 is small (residual aberrations) calculate sensitivity directly

$$\frac{\partial\Phi}{\partial x_i} \cong \frac{\Phi(x_i + \Delta x_i) - \Phi_0}{\Delta x_i} \cong \frac{\Phi(x_i + \Delta x_i)}{\Delta x_i}$$

Δx_i is perturbation (by the expected tolerance)

$\Phi(x_i + \Delta x_i)$ is the system merit function of the perturbed system

- To include the nominal merit function Φ_0

This can be tricky

Evaluate Φ_0 and $\Phi(x_i + \Delta x_i)$

- If $\Phi_0 \ll \Phi(x_i + \Delta x_i)$ then $\Delta\Phi = \Phi(x_i + \Delta x_i)$ as above
- If Φ_0 is correlated with $\Phi(x_i + \Delta x_i)$ then $\Delta\Phi = \Phi(x_i + \Delta x_i) - \Phi_0$
- Else Φ_0 and $\Delta\Phi$ combine in RSS, so

$$\Delta\Phi = \sqrt{(\Phi(x_i + \Delta x_i))^2 - \Phi_0^2}$$

Using compensators

For most optical systems, a final focus adjustment will be made after the system is assembled. The tolerance analysis must take this into account.

When calculating the effect of each perturbation, you simulate this adjustment:

- simulate sensing the error
- adjust the appropriate parameter

This can be used for other degrees of freedom

Always make the simulation follow the complete procedure.

Every compensator requires a real measurement and a real adjustment. The limitations of the measurements and adjustments should show up in your error budget.

Combining different effects

Calculate system merit function by scaling from the sensitivities, and use RSS

$$\Phi = \sqrt{\Phi_0^2 + \left(\frac{\partial \Phi}{\partial x_1} \cdot \Delta x_1 \right)^2 + \left(\frac{\partial \Phi}{\partial x_2} \cdot \Delta x_2 \right)^2 + \dots}$$

Δx_i is now the tolerance for x_i , which could be adjusted

$\frac{\partial \Phi}{\partial x_i}$ is the sensitivity to unit change in parameter x_i

Put the sensitivities into a spreadsheet to allow easy calculation of the system errors with all effects.

Spreadsheet for combining tolerances

Parameter	Tolerance	Sensitivity	Effect on merit function
x_1	Δx_1	$\frac{\partial \Phi}{\partial x_1}$	$= \Delta x_1 \cdot \frac{\partial \Phi}{\partial x_1}$
x_2	Δx_2	$\frac{\partial \Phi}{\partial x_2}$	$= \Delta x_2 \cdot \frac{\partial \Phi}{\partial x_2}$
x_3	Δx_3	$\frac{\partial \Phi}{\partial x_3}$	$= \Delta x_3 \cdot \frac{\partial \Phi}{\partial x_3}$
.	.	.	.
.	.	.	.
Root Sum Square			= sqrt(sumsq(D1:D23))

You can change the tolerance value

Sensitivities calculated from simulation. These do not change

Automatically recalculate effect from each term and RSS


Confidence Levels

We assume Gaussian statistics:

This makes it easy

On average, it is correct

Any one system will NOT follow such

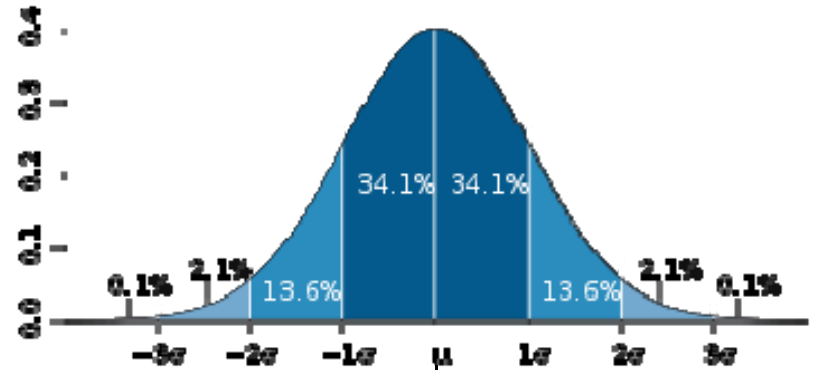

Use tolerance analysis to establish confidence levels

Range	$\pm \sigma$	$\pm 2 \sigma$	$\pm 3 \sigma$
Confidence level	68%	95%	99.7%

Common assumptions for tolerancing:


All error terms are handled so that the tolerated value represents $\pm 2\sigma$ or 95% confidence

Then the RSS of all of these can be interpreted as $\pm 2\sigma$ or 95% confidence

This provides 95% yield (5% rejection)

Monte Carlo analysis can provide similar results

LOS Tolerancing example

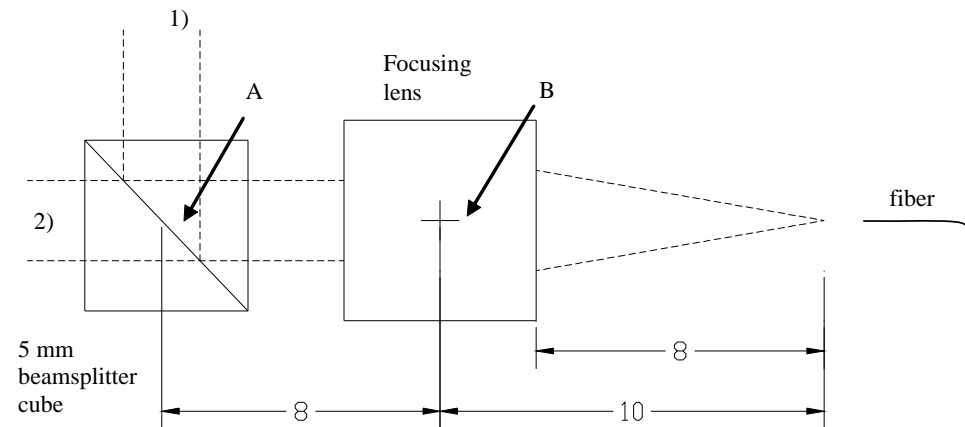

A) Determine the focal length of the lens and find its nodal point.

Calculate the following sources of error, consider the effects for both inputs

- B) Lateral translation of beamsplitter cube $20 \mu\text{m}$
- C) Rotation of the beamsplitter cube about point A of $3 \mu\text{rad}$
- D) Lateral translation of the focusing lens of $0.1 \mu\text{m}$
- E) Rotation of focusing lens about point B of $20 \mu\text{rad}$ (decompose motion into rotation about nodal point + translation of nodal point.)
- F) Lateral translation of the fiber of $0.1 \mu\text{m}$
- G) Calculate the combined effect of all of the above. How does this compare to the requirement?

Show how to meet a requirement of $0.1 \mu\text{m}$ stability

Example Spreadsheet

1. Sensitivities -- Find these by analysis

	From analysis	Sensitivity	
	Beam #1		
	Perturbation	(μm)	
B) Lateral translation of beamsplitter cube (μm)	20	0	0 $\mu\text{m}/\mu\text{m}$
C) Rotation of the beamsplitter cube about point A (μrad)	3	0.09	0.03 $\mu\text{rad}/\mu\text{m}$
D) Lateral translation of the focusing lens of (μm)	0.1	0.1	1 $\mu\text{m}/\mu\text{m}$
E) Rotation of focusing lens about point B of (μrad)	20	0.1	0.005 $\mu\text{m}/\mu\text{rad}$
F) Lateral translation of the fiber (μm)	0.1	0.1	1 $\mu\text{m}/\mu\text{m}$

Simply scale the effects

Enter new tolerance value

Excel multiplies by sensitivity to give net contribution

2. Scale to see effect of changing tolerances

	Tolerance	Sensitivity	Beam #1 (μm)
B) Lateral translation of beamsplitter cube (μm)	20	0.000	0
C) Rotation of the beamsplitter cube about point A (μrad)	3	0.030	0.09
D) Lateral translation of the focusing lens of (μm)	0.1	1.000	0.1
E) Rotation of focusing lens about point B of (μrad)	20	0.005	0.1
F) Lateral translation of the fiber (μm)	0.1	1.000	0.1
RSS			0.20

Assigning initial tolerances

- Start with rational, easy to achieve tolerances
- Only tighten these as your analysis requires
- Rules of thumb for element tolerances
- Rules of thumb for assembly tolerances
- ***Best -- know what the fabrication and alignment processes you plan to use will give!***

Using optical design codes

- Much of the above work can be done entirely within the optical design code.
- You can specify tolerances, and the software will calculate sensitivities and derive an RSS
- **Be careful with this!** It is easy to get this wrong.
- The optical design codes also include a useful Monte Carlo type tolerance analysis. This creates numerous simulations of your system with all of the degrees of freedom perturbed by random amounts.

Develop complete set of tolerances

- Simulate system performance
 - Include all compensators
- Check overall magnitudes of the terms
 - Terms with small effects, loosen tolerances
 - Terms with big effects, may need to tighten tolerances
- Revise fabrication, alignment plans as needed the goal is:
 - 1. Meet performance specifications**
 - 2. Minimize cost**

Mechanical tolerancing

- This is a huge, important subject for opto-mechanical engineers.
- Basic types of tolerances for optical systems
 - General position tolerances
 - lens spacing and alignment
 - Surface texture
 - comes from fabrication process
 - Level of constraint
 - overconstrain for stiffness, clearance for motion
 - interference or clearance for optic mounts

Dimensional tolerances for machined parts

- Depends on fabrication methods and equipment so **discuss these with your fabricator!**
- Rules of thumb for machined parts
 - ± 1 mm for coarse dimensions that are not important
 - ± 0.25 mm for typical machining without difficulty
 - ± 0.025 mm precision machining, readily accessible
 - $< \pm 0.002$ mm high-precision, requires special tooling

Dimensional tolerancing of optical elements

- Diameter
- Clear aperture
- Thickness
- Wedge
- Angles
 - wedge or optical deviation for lenses
 - angles for prisms
- Bevels
- Mounting surfaces

Start with nominal tolerances from fabricator

Tolerancing surface figure

- Specifications are based on measurement
 - Inspection with test plate.
Typical spec: 0.5 fringe
 - Measurement with phase shift interferometer.
Typical spec: 0.05λ rms
- For most diffraction limited systems, rms surface gives good figure of merit
- Special systems require PSD spec
- Geometric systems really need a slope spec, but this is uncommon. Typically, you assume the surface irregularities follow low order forms and simulate them using Zernike polynomials

This topic is covered in detail in OPTI 415/515

Define assembly procedure

- Determine adjustments that will be made in assembly that can compensate other errors
 - Each of these needs a measurement to know how to set it
 - Consider several things --
 - Range of adjustment
 - Resolution required (for motion and for measurement)
 - Required accuracy of motion and measurement
 - Frequency of adjustment
- Other dimensions will be set once (like lenses in cells)

Tolerancing optical assemblies

- Element spacing
- Tilt of elements
- Mounting decenter
- Mounting distortion
- Include stability and thermal errors

Get nominal tolerances from assembly and alignment procedures

Work with the mechanical designer

Rules of thumb for optical assemblies

Parameter	Base	Precision	High precision
Spacing (manual machined bores or spacers)	200 μm	25 μm	6 μm
Spacing (NC machined bores or spacers)	50 μm	12 μm	2.5 μm
Concentricity (if part must be removed from chuck between cuts)	200 μm	100 μm	25 μm
Concentricity (cuts made without de-chucking part)	200 μm	25 μm	5 μm

Base: Typical, no cost impact for reducing tolerances beyond this.

Precision: Requires special attention, but easily achievable in most shops, may cost 25% more

High precision: Requires special equipment or personnel, may cost 100% more

Example – 2 element null corrector

Table 3. Accuracy for null lens fabrication

<u>Quantity</u>	<u>Tolerance</u>
Lens spacing	50 μm
Lens thickness	25 or 50 μm
Radius of curvature	1 fringe power or 25 μm (whichever is smaller)
Flatness	$\lambda/4$
Surface figures	0.008 λ rms interferometer 0.015 λ rms lenses
Index of refraction	± 0.0002 (Grade A BK7)
Index Inhomogeneity	0.25 E-6 rms (H4 grade)
Wedge in lenses	50 μm
Decenter in mounting	50 μm
Tilt in mounting	50 μm
Primary radius of curvature	2 mm

Table 4. Tolerances for null lens

	units	Design value	Tolerance (Allowable Error)	Spherical aberration (nm rms)	Figure (nm rms)
Interferometer					
Irregularity (rms)	waves		0.008		5.06
Decenter	μm		0.050	0.00	0.03
Airspace					
	mm	103.972	0.05	1.36	0.00
Relay Lens:					
Curvature 1	/mm	0.00E+00	2E-06	0.22	0.02
Thickness	mm	10.386	0.025	0.47	0.02
Radius 2	mm	41.595	0.025	0.26	0.03
Irregularity 1 (rms)	waves		0.015		4.89
Irregularity 2 (rms)	waves		0.015		4.89
Index		1.51509	2E-04	1.17	0.02
Inhomogeneity	rms		2.5E-7		2.60
Wedge	μm		50	0.00	0.07
Decenter	μm		50	0.00	0.07
Tilt	μm		50	0.00	0.09
Airspace					
	mm	150.418	0.050	1.00	0.02
Field Lens:					
Radius 1	mm	129.681	0.050	0.88	0.04
Thickness	mm	2.924	0.050	0.01	0.02
Curvature 2	/mm	0.00E+00	1.4E-06	0.20	0.03
Irregularity 1 (rms)	waves		0.015		4.89
Irregularity 2 (rms)	waves		0.015		4.89
Index		1.51509	2E-04	0.89	0.03
Inhomogeneity	rms		2.5E-7		0.73
Wedge	μm		50	0.00	0.10
Decenter	μm		50	0.00	0.06
Tilt	μm		50	0.00	0.09
Residual Wavefront	waves		0.000182	0	0.06
Primary Radius	mm	7000	2	0.52	0.02
RSS				3	11.34

Error Tree

